Service Bulletin Mazda North American Operations

Irvine, CA 92618-2922



© 2016 Mazda Motor of America, Inc.

Subject: **Bulletin No:** 05-007/16 UNUSUAL NOISE FROM MANUAL TRANSMISSION WHEN DRIVING IN 2ND AND **OR 3RD GEAR** Last Issued: 10/28/2016

APPLICABLE MODEL(S)/VINS

2016-17 MX-5 vehicles with VINs lower than JM1ND*****102648 (produced before September 6, 2016)

DESCRIPTION

Some vehicles may exhibit one or more of the following symptoms with the manual transmission.

- An unusual noise occurs from the transmission when it is shifted from 1st to 2nd and/or from 2nd to 3rd gear.
- It is impossible to shift into 2nd and/or 3rd gear while there is no problem shifting into other gears.
- There is an unusual noise from the transmission while it is in the neutral position and the engine is idling.

This may be caused by damage to 2nd and/or 3rd gears if the vehicle was driven with rapid acceleration and deceleration using frequent shift changes. To eliminate this concern, the configuration of the 2nd and 3rd gears has been changed to increase the rigidity.

NOTE: Transmissions with the serial No. "6TJ0900496" or higher are modified.



Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE


- 1. Verify the customer concern
- 2. Replace the complete manual transmission with a modified one according to the instructions on MS3 (TRANSMISSION REMOVAL/INSTALLATION [M66M-D]).
- 3. Verify the repair


Bulletin No: 05-007/16	Last Issued: 10/28/2016
© 2016 Mazda Motor of America, Inc.	

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
M602-03-000	Manual Transmission Complete	1	
9994-61-000	Nut, TWC (T)	2	А
PE23-40-305	Gasket, TWC (T)	1	В
RFK2-40-581	Seal Ring, TWC (T)	1	С
1368-25-124	Nut, Propeller Shaft (P)	4	D
9997-11-000	Spring Washer, Propeller Shaft (P)	4	E

Replacement Parts Location

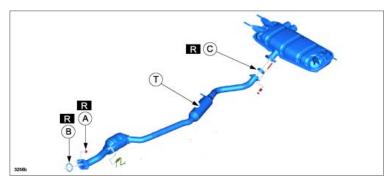

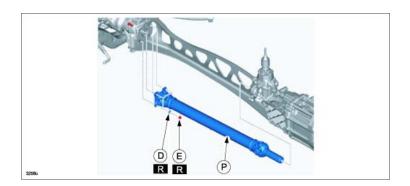

Bulletin No: 05-007/16	Last Issued: 10/28/2016
© 2016 Mazda Motor of America, Inc.	

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's Powertrain Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	А
Symptom Code	24
Damage Code	9A
Part Number Main Cause	M602-03-000
Quantity	1
Operation Number / Labor Hours:	XXM9GARX / 4.7 Hrs. (Without front suspension tower bar) XXM9GBRX / 4.8 Hrs. (With front suspension tower bar)